


Technical Bulletin

No: 1001 – 4x4a Audio Present LED

Symptom: The green audio present LED's illuminate continuously when connected to a Radio System's digital console.

Solution: Solder a .01uf film capacitor (RS Part #5860) across R54 on both the slave (RS Part #11080) board and Power (RS Part #11078) Board. *

*2x4a Only

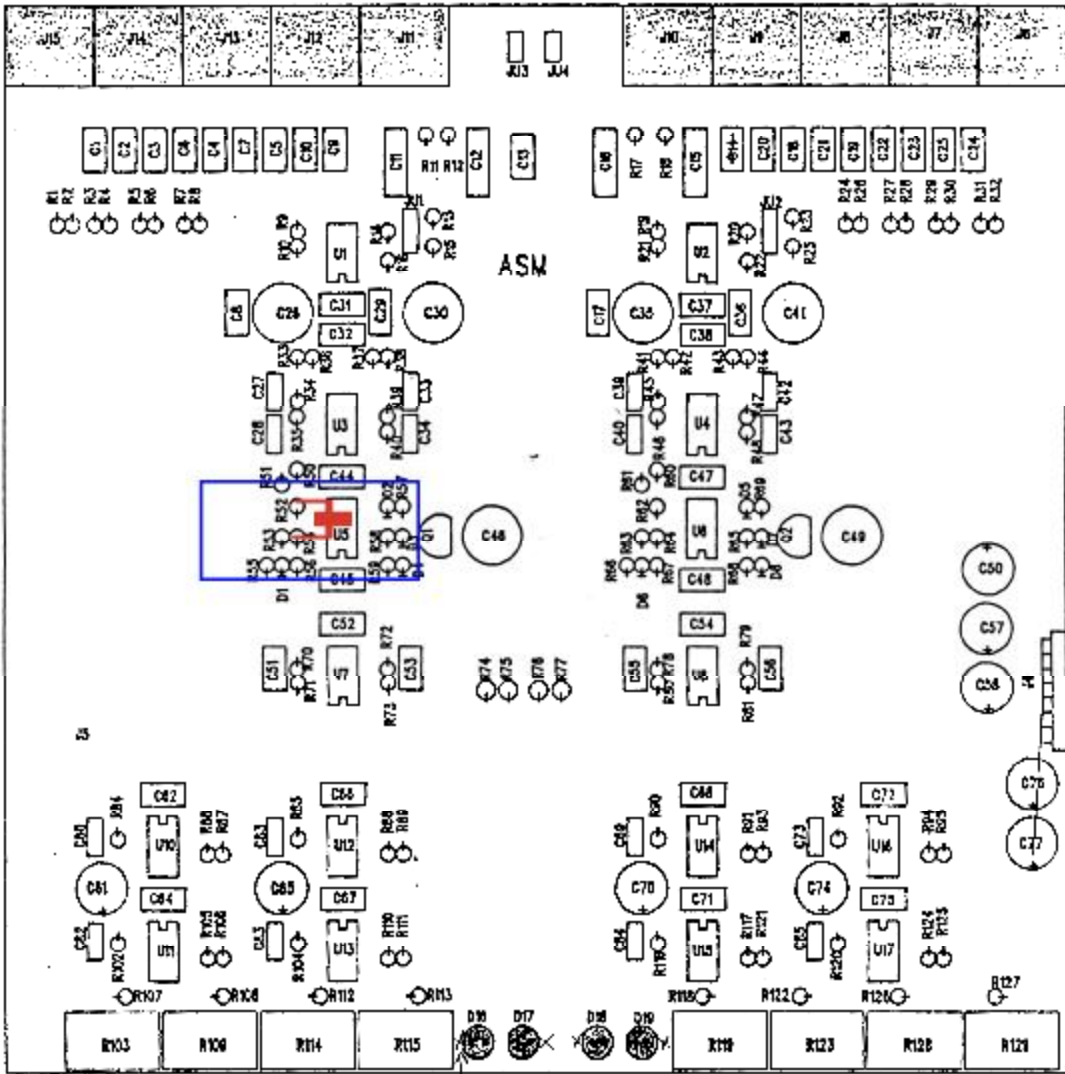

601 Heron Drive
 Logan Township, NJ 08085
 Phone: 856-467-8000 • Fax: 856-467-3044
<http://www.radiosystems.com>